


## Dimensions adapters BSP Parallel Thread (RS)

Compression type	1/8"BSPP	1/4"BSPP	1/2"BSPP	1"BSPP
	A	A	A	A
adapter 3 mm OD	25.3	26.1		
adapter 6 mm OD	27.6	28.4	29.2	
adapter 8 mm OD	28.6	29.4	30.2	
adapter 10 mm OD		30.2	31.0	
adapter 12 mm OD	32.2	32.5	33.5	
adapter 15 mm OD			33.6	
adapter 16 mm OD			33.5	
adapter 18 mm OD			34.8	
adapter 20 mm OD			36.5	
adapter 25 mm OD			42.0	41.7
adapter 1/16" OD	20.6			
adapter 1/8" OD	25.3	26.1		
adapter 1/4" OD	27.6	28.4	29.2	
adapter 3/8" OD	29.5	29.9	30.7	
adapter 1/2" OD		32.7	33.5	
adapter 3/4" OD			34.8	
adapter 1" OD			41.6	41.7


BSP Parallel Thread (RS)  
 Compression type

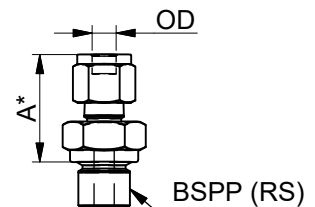

\*) Dimension A is typical finger-tight.

O-ring face-seal	1/8"BSPP	1/4"BSPP	1/2"BSPP
	A	A	A
adapter 1/4" inlet	19.8	19.8	
adapter 1/2" inlet		22.8	22.8
adapter 3/4" inlet			25.3


BSP Parallel Thread (RS)  
 O-ring face-seal

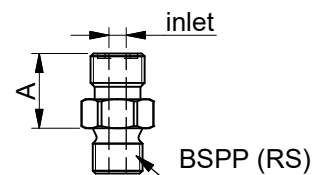

tol. dimension A = ± 0.1

Face-seal	1/8"BSPP	1/4"BSPP	1/2"BSPP
	A	A	A
adapter 1/8" inlet	17.8	19.3	
adapter 1/4" inlet	23.7	23.2	
adapter 1/2" inlet		27.8	27.6
adapter 3/4" inlet			36.5

BSP Parallel Thread (RS)

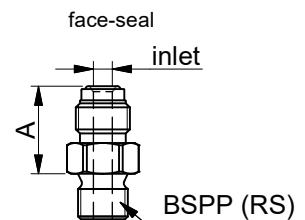

tol. dimension A = ± 0.1